

Injectronics

Remanufactured Automotive Electronics Components

PRODUCT SERVICE INFORMATION

Document number: P0035

For further technical information regarding testing, repairs or to search for New or Remanufactured Automotive electronic products, please visit www.injectronics.com.au, call our office on (+613) 8792 6999, or email sales@injectronics.com.au

Vehicle: Toyota RAV 4

Subject: ECM communication registration procedure


When an exchange ECM from Injectronics, it is important that the following notes are understood & procedure followed.

- The ECM communication ID needs to be registered when the engine ECM is replaced.
- The engine cannot be started unless the ECM communication ID matches.
- The ECM communication ID must be registered before turning the ignition switch from on to off 20 times or more consecutively. If not done, the transponder key ECM (immobiliser) will need to be replaced.

Procedure:

- Insert a jumper wire between terminals TC and CG of the diagnostic connector. The 16 pin OBD2 diagnostic connector is located under the driver side dash panel.
- Insert the ignition key into the barrel, turn the ignition switch to on (do not start the engine), and leave ignition on for 30 minutes.
- Turn the ignition switch to off and disconnect the jump wire from the diagnostic connector.
- Turn the ignition on and start the engine.

16 pin OBD2 diagnostic connector

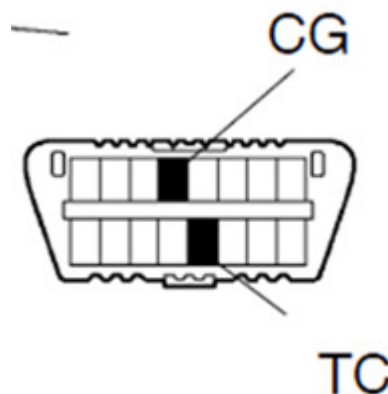

P0035.doc